

Cummins PCC3100 Installation Guide One Link v2

Installation Instructions:

1. Put the generator in stop mode.

2. Disconnect the positive battery terminal.(Do not reconnect the positive battery terminal until step 19.)

3. Using the magnetic mounts, mount the One Link inside of the generator enclosure close to the controller. (Be sure the mounting location is away from weather exposure.)

4. Connect the ring connector on the **red** wire of the battery wiring harness to the positive (+) battery terminal.

5. Connect the ring connector on the **black** wire of the battery wiring harness to the negative (-) battery terminal.

6. Route the **red** wire, **red/white** wire, and **black** wire from the One Link I/O cable to the battery wiring harness installed in steps 4 and 5.

7. Using one of the included lever wire connectors, connect the bare black wire from the battery wiring harness to the red/white wire and black wire from the One Link I/O cable.

8. Using one of the included lever wire connectors, connect the bare **red** wire from the battery wiring harness to the **red** wire from the One Link I/O cable.

Panel:



Parts List:



OLM003B



Lever Connectors(2)



Installation Instructions(cont.)

9. Route the **red** wire with **black** stripe from the One Link I/O cable to TB1-5 on the back of the panel.

10. Route the **blue** wire with **black** stripe from the One Link I/O cable to TB1-8 on the back of the panel.

11. Route a jumper wire from TB2-41 to battery negative.

12. Route the black wire with **white** stripe from the One Link I/O cable to TB2-42 on the back of the panel.

13. Route the green wire with **white** stripe to the back of the amp meter.

14. Route the **white** wire to L1 to the breaker.

15. Route the **white** wire with **black** stripe to L2 to the breaker.

16. Mount the LTE/GPS antenna on the top of the generator.

17. Connect the LTE antenna cable to the top connector on the right side of the One Link.

18. Connect the GPS antenna cable to the bottom connector on the right side of the One Link.



Installation Instructions(cont.)

19. Plug the 15 pin connector into the bottom of the One Link, and tighten both screws using a flathead screwdriver.

20. Reconnect the positive battery terminal to the battery.

At this time the One Link will power up and begin communicating with the generator. Please allow 5-10 minutes for the One Link to establish a connection to the internet. Check the activation screen or your One Link account to ensure the generator's vitals update, and the One Link is transmitting data.

1 (888) 366-7886



Cummins PCC3100 TX Installation Guide One Link v2

TX Installation

1. Connect the **red** wire from the OneLink I/O cable to the Normally Closed terminal on J18.

2. Connect the Common terminal on J18 to ground.

3. Connect the Common terminal on S1 to ground.

4. Connect the **pink** wire from the OneLink I/O cable to the Normally Open contact on S1.